





















## 4 Vorbereitung

### 4.1 Stromversorgung














Als Stromversorgung werden drei AAA-Alkalibatterien benötigt. Bevor Sie die Batterien tauschen, schalten Sie das Gerät aus. Das Batteriefach befindet sich auf der Rückseite des Geräts und ist mit zwei Schrauben gesichert. Lösen Sie die Schrauben, heben Sie die Abdeckung ab, legen Sie die Batterien wie gekennzeichnet ein und verschließen Sie das Batteriefach wieder, indem Sie die Schrauben anziehen.


### 4.2 Inbetriebnahme

Um das Gerät zu starten, drücken Sie , bis das Display reagiert. Das Messgerät zeigt nach dem Laden den Messbildschirm an. Zum Ausschalten drücken Sie . Verbinden Sie den im Lieferumfang enthaltenen Sensor FN1,5 mit der Anschlussbuchse des Geräts. Achten Sie dabei auf die korrekte Positionierung des Steckers (Pfeil muss von Gerätevorderseite zu sehen sein).

### 4.3 Optionen

Um die Standardeinstellungen zu ändern, müssen Sie in das Untermenü „Optionen“ navigieren. Gehen Sie dafür wie folgt vor:

1. Drücken Sie , um ins „Menü“ zu gelangen.
2. Navigieren Sie mit   zu „Optionen“ und bestätigen Sie mit  .
3. Navigieren Sie mit   zu den gewünschten Einstellungen und bestätigen Sie mit  .
4. Wählen Sie mit   ein Element aus und bestätigen Sie mit  .

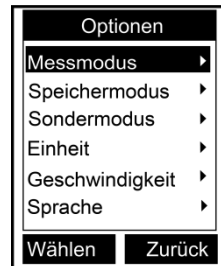

Einstellung	Element	Erläuterung
Messmodus	Einzeln	Aufnahme einzelner Messwerte
Speichermodus	DIR, GEN Block 1, Block 2, Block 3, Block 4	DIR (Direkt): Die Daten gehen beim Ausschalten des Geräts verloren. Bei vollem Speicher werden die letzten Messwerte gelöscht. GEN (Block 1-4): Die Daten werden in einem der 4 Blöcke abgespeichert und gehen beim Ausschalten nicht verloren. Bei vollem Speicher kann weiter gemessen werden, jedoch wird „fl“ angezeigt und die Messwerte werden nicht gespeichert.
Sensormodus	Auto, FE, N- FE	Auto: Das Untergrundmaterial wird automatisch erkannt. FE: Es kann nur auf magnetischen Materialien gemessen werden. N-FE: Es kann nur auf nicht-magnetischen Materialien gemessen werden. Wenn ein magnetisches Material erkannt wird, zeigt das Gerät ein „F“ an, bei nicht magnetischen Materialien ein „N“.






## 5.1 Kalibrieren

Eine Kalibrierung (Nullpunkt / Mehrpunkt) ist vor jeder Messung einer neuen Probe erforderlich. Dabei müssen die Materialeigenschaften und der Krümmungsradius der unbeschichteten Kalibrierfläche so ähnlich wie möglich zur Probe sein. Nicht nur, aber vor Allem bei Messungen an Ecken und Kanten kleiner Teile sollte darauf geachtet werden, dass an möglichst ähnlichen Stellen kalibriert bzw. gemessen wird. Der Krümmungsradius, die Mindestschichtdicke und der Mindestmessbereich aus Kapitel 2.1 sollten eingehalten werden. Das Gerät bietet eine Nullpunktkalibrierung und eine Mehrpunktkalibrierung. Jede Speichergruppe verfügt über eine individuelle Nullpunkt- und Mehrpunktkalibrierung. Die zuvor aufgenommenen Messwerte werden durch eine neue Kalibrierung nicht beeinflusst.

### 5.1.1 Nullpunktkalibrierung


Bei der Nullpunktkalibrierung wird die Kalibrierung auf einer unbeschichteten Kalibrierfläche durchgeführt. Wenn es keine Möglichkeit gibt, auf der Probe zu kalibrieren, nutzen Sie die mitgelieferten Kalibrierplatten. Wenn bei der Messung ein Messfehler von  $\pm(2\% + 1\ \mu\text{m})$  auftritt, wird die Nullpunktkalibrierung empfohlen. Gehen Sie wie folgt vor:


1. Halten Sie  gedrückt, bis Sie drei Pieptöne hören und auf dem Display „ZERO“ erscheint.
2. Platzieren Sie den Sensor auf der unbeschichteten Kalibrierfläche und heben Sie ihn wieder an, wenn Sie einen Piepton hören.
3. Wiederholen Sie den Schritt mehrmals, um einen Mittelwert zu erhalten.
4. Drücken Sie , um die Nullpunktkalibrierung zu verlassen.

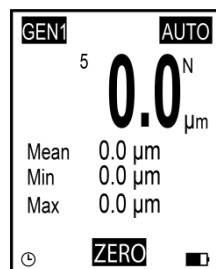




### 5.1.2 Mehrpunktkalibrierung

Bei der Mehrpunktkalibrierung können bis zu 4 Punkte zur Kalibrierung aufgenommen werden. Bei einer Einpunktkalibrierung sollte der Kalibrierwert möglichst nah am zu erwartenden Messwert liegen. Bei einer Mehrpunktkalibrierung sollten die zu erwartenden Messwerte zwischen den Kalibrierwerten liegen. Der zulässige Messfehler beträgt maximal  $\pm(2\% + 1\ \mu\text{m})$ .

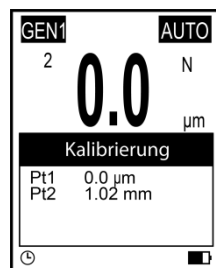1. Wenn Sie schon eine Kalibrierung vorgenommen haben, müssen Sie zunächst, wie in Kapitel 5.1.3 beschrieben, die schon aufgenommenen Kalibrierwerte löschen. Anderenfalls starten Sie mit dem nächsten Schritt.
2. Drücken Sie im Messmodus , um das Kalibrierdialogfeld zu öffnen. Dies können Sie zudem in den Kalibriereinstellungen aktivieren und deaktivieren.
3. Wenn Sie zuvor die Nullpunktkalibrierung durchgeführt haben, wird der Nullpunkt als erster Kalibrierpunkt angezeigt. Anderenfalls führen Sie die in Kapitel 5.1.1 beschriebenen Schritte durch.
4. Legen Sie eine der mitgelieferten Standardfolien auf die unbeschichtete Kalibrierfläche.
5. Platzieren Sie den Sensor auf der Folie und entfernen Sie ihn nach dem Piepton wieder. Der Messwert wird angezeigt.



6. Stellen Sie mit  den Messwert auf die tatsächliche Foliendicke ein (blinkender Wert) und bestätigen Sie mit . Der Kalibrierpunkt wird danach im Dialogfeld angezeigt (nicht blinkender Wert). Mit  kann der Vorgang abgebrochen werden.

- Wiederholen Sie, wenn gewünscht, die Schritte, um alle vier Kalibrierpunkte aufzunehmen. Dazu nutzen Sie für jeden weiteren Kalibrierpunkt eine andere Standardfolie.
- Drücken Sie  $\left[ \text{CAL} \right]$ , um die Mehrpunktkalibrierung zu verlassen.

### 5.1.3 Kalibrierung löschen

Um eine neue Kalibrierung durchzuführen, können Sie die aufgenommenen Kalibrierpunkte der Nullpunktkalibrierung und Mehrpunktkalibrierung unabhängig voneinander löschen. Gehen Sie dazu wie folgt vor:

- Drücken Sie  $\left[ \text{ENTER} \right]$ , um ins „Menü“ zu gelangen.
- Navigieren Sie mit  $\left[ \text{DEL} \right]$  /  $\left[ \text{OFFEN} \right]$  zu „Kalibrierung“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
- Wählen Sie nach den folgenden Punkten (a, b, c) aus, welche Werte Sie löschen möchten.



#### a) Mehrpunktkalibrierwerte löschen

- Navigieren Sie mit  $\left[ \text{DEL} \right]$  /  $\left[ \text{OFFEN} \right]$  auf „Punkt Kal.“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
- Navigieren Sie mit  $\left[ \text{DEL} \right]$  /  $\left[ \text{OFFEN} \right]$ , wie gewünscht auf „FE löschen“ oder „N-FE löschen“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
- Es öffnet sich ein Dialogfeld. Bestätigen Sie mit  $\left[ \text{ENTER} \right]$ , um die Kalibrierwerte zu löschen oder brechen Sie den Vorgang mit  $\left[ \text{BACK} \right]$  ab.

#### b) Nullpunktkalibrierwerte löschen

- Navigieren Sie mit  $\left[ \text{DEL} \right]$  /  $\left[ \text{OFFEN} \right]$  auf „Null Kal.“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
- Navigieren Sie mit  $\left[ \text{DEL} \right]$  /  $\left[ \text{OFFEN} \right]$ , wie gewünscht auf „FE löschen“ oder „N-FE löschen“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
- Es öffnet sich ein Dialogfeld. Bestätigen Sie mit  $\left[ \text{ENTER} \right]$ , um die Kalibrierwerte zu löschen oder brechen Sie den Vorgang mit  $\left[ \text{BACK} \right]$  ab.

#### c) Alle Kalibrierwerte löschen

- Navigieren Sie mit  $\left[ \text{DEL} \right]$  /  $\left[ \text{OFFEN} \right]$  auf „Alle Löschen“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
- Es öffnet sich ein Dialogfeld. Bestätigen Sie mit  $\left[ \text{ENTER} \right]$ , um alle Kalibrierwerte zu löschen oder brechen Sie den Vorgang mit  $\left[ \text{BACK} \right]$  ab.

## 5.2 Messen









Vorgehen:

- Schließen Sie zu Anfang den gewünschten Sensor wie in Kapitel 4.2 beschrieben an.
- Passen Sie die Geräteeinstellungen, wie in Kapitel 4.3 beschrieben, an Ihre Zwecke an (Messmodus, Speichermodus, Sensormodus, Geschwindigkeit).
- Führen Sie vor der Messung eine Nullpunktkalibrierung und eine Mehrpunktkalibrierung durch (Kapitel 5.1).
- Setzen Sie den Sensor senkrecht auf die zu messende Fläche. Warten Sie, bis das Gerät einen Piepton ausgibt und heben Sie den Sensor wieder hoch.

## 5.3 Weitere Messfunktionen






 


### 5.3.1 Daten löschen

#### Letzten Messwert löschen

- Wenn Sie im Messmodus sind, drücken Sie die -Taste, um den zuletzt aufgenommenen Wert zu löschen.
- 1. Drücken Sie , um ins „Menü“ zu gelangen.
- 2. Navigieren Sie mit  zu „Daten löschen“ und bestätigen Sie mit .
- 3. Navigieren Sie mit  zu „Aktuelle Daten“ und bestätigen Sie mit .
- 4. Es öffnet sich ein Dialogfeld. Bestätigen Sie mit , um den letzten Messwert zu löschen oder brechen Sie den Vorgang mit  ab.








#### Aktuelle Speichergruppe löschen

- Wenn Sie im Messmodus sind, halten Sie die -Taste gedrückt, bis ein weiterer Piepton erklingt, um die gesamten aufgenommenen Werte der Speichergruppe zu löschen.
- 1. Drücken Sie , um ins „Menü“ zu gelangen.
- 2. Navigieren Sie mit  zu „Daten löschen“ und bestätigen Sie mit .
- 3. Navigieren Sie mit  zu „Aktuelle Block“ und bestätigen Sie mit .
- 4. Es öffnet sich ein Dialogfeld. Bestätigen Sie mit „Enter“ , um die gesamten aufgenommenen Werte der Speichergruppe zu löschen oder brechen Sie den Vorgang mit  ab.

Um die anderen Speichergruppen und Werte zu löschen, müssen Sie, wie in Kapitel 4.3 beschrieben, die Speichergruppe wechseln und erneut die Schritte zum Löschen befolgen.

### 5.3.2 Werte löschen

Drücken Sie , um ins „Menü“ zu gelangen. Navigieren Sie mit  zu „Werte löschen“ und bestätigen Sie mit . Sie sehen nun anhand der links oben stehenden Zahl (3/4) den aktuell ausgewählten Messwert der Speichergruppe. Mit  wählen Sie den gewünschten Messwert aus und können diesen durch Drücken von  löschen.



### 5.3.3 Statistik

Bei der Messwertaufnahme im Messmodus wird der aktuelle Mittelwert, der Maximal- und der Minimalwert unter dem Messwert angezeigt. Um in die vollständige Statistikfunktion zu gelangen, drücken Sie zunächst  $\left[ \text{ENTER} \right]$ . Im angezeigten Menü gehen Sie mit  $\left[ \text{DEL} \right]$  auf „Statistik“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ . Nun sehen Sie die Statistikwerte der aktuell ausgewählten Speichergruppe. Um die Statistik der anderen Speichergruppen zu sehen, müssen Sie, wie in Kapitel 4.3 beschrieben, die Speichergruppe wechseln und erneut in die Statistikfunktion gehen.

Statistik	
Nummer	3
Durch	32.9um
Min	0.0um
Max	49.9um
StAw	28.5um
<b>Zurück</b>	

Das Messgerät ermittelt aus den gespeicherten Messwerten jeder Speichergruppe eine eigene Messwertstatistik. In der Statistik werden die Anzahl der Messwerte, der Mittelwert, der Minimalwert, der Maximalwert und die Standardabweichung angezeigt. Im Direktmodus wird bei vollem Speicher der erste Messwert gelöscht und der neue Messwert abgespeichert. Die Statistik wird in Folge aktualisiert. Wenn der Speicher im Blockmodus voll ist, werden keine neuen Messwerte gespeichert und die Statistik wird nicht mehr aktualisiert. Falls der Benutzer den aktuellen Messwert oder auch die gesamten Messwerte der Gruppe löscht, aktualisiert sich die Statistik.

### 5.3.4 Grenzwerteinstellung

Jede Speichergruppe verfügt über einen individuellen oberen und unteren Grenzwert. Beim Wechseln der Speichergruppe werden die Grenzwerte der Gruppe automatisch übernommen. Beim Über- bzw. Unterschreiten des Grenzwertes leuchtet die linke rote LED. Zudem wird beim oberen Grenzwert auf dem Display das Symbol  $\uparrow$  und beim unteren Grenzwert  $\downarrow$  angezeigt.

Um den oberen und unteren Grenzwert einzugeben, gehen Sie wie folgt vor:

1. Drücken Sie  $\left[ \text{ENTER} \right]$ , um ins „Menü“ zu gelangen.
2. Navigieren Sie mit  $\left[ \text{DEL} \right]$  zu „Limit“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
3. Navigieren Sie mit  $\left[ \text{DEL} \right]$  zu „Eingeben“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
4. Navigieren Sie mit  $\left[ \text{DEL} \right]$  wie gewünscht auf „Oberes Limit“ oder „Unteres Limit“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
5. Stellen Sie mit  $\left[ \text{DEL} \right]$  den Grenzwert ein und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ , oder brechen Sie mit  $\left[ \text{BACK} \right]$  ab.


Limit Einst.	
Oberes Limit	$\rightarrow$
Unteres Limit	$\rightarrow$
<b>Wählen</b>   <b>Exit</b>	

Um den oberen und unteren Grenzwert zu löschen, gehen Sie wie folgt vor:

1. Drücken Sie  $\left[ \text{ENTER} \right]$ , um ins „Menü“ zu gelangen.
2. Navigieren Sie mit  $\left[ \text{DEL} \right]$  zu „Limit“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
3. Navigieren Sie mit  $\left[ \text{DEL} \right]$  zu „Löschen“ und bestätigen Sie mit  $\left[ \text{ENTER} \right]$ .
4. Es öffnet sich ein Dialogfeld. Bestätigen Sie mit  $\left[ \text{ENTER} \right]$ , um die Grenzwerte der Speichergruppe zu löschen oder brechen Sie den Vorgang mit  $\left[ \text{BACK} \right]$  ab.







Um die Grenzwerte der anderen Speichergruppen einzugeben oder zu löschen, müssen Sie, wie in Kapitel 4.3 beschrieben, die Speichergruppe wechseln und erneut die oben beschriebenen Schritte befolgen.

### 5.3.1 USB Kommunikation (nur möglich bei Zukauf der Software)

Das Messgerät kann über den Micro-USB 2.0 Anschluss an den PC angeschlossen werden und damit kommunizieren. Dazu müssen Sie zunächst die Software und den USB-Treiber für das Messgerät installieren. Danach schließen Sie das Messgerät mit dem USB-Kabel an den Computer an. Bei erfolgreicher Verbindung wird unten im Bildschirm das Symbol  angezeigt. Nun können Sie die Messdaten auf dem PC verwalten, formatieren, drucken oder für andere Dokumente kopieren.

### 5.3.2 System zurücksetzen

Um das Messgerät auf Werkseinstellungen zurückzusetzen, gehen Sie wie folgt vor:

1. Schalten Sie das Gerät mit  aus.
2. Halten Sie die -Taste gedrückt und schalten Sie mit  das Gerät ein.
3. Wenn das Dialogfeld zum Zurücksetzen angezeigt wird, lassen Sie die -Taste los.
4. Um das Gerät zurückzusetzen, bestätigen Sie mit , oder brechen Sie den Vorgang mit  ab. Das Gerät startet automatisch neu.



## 6 Garantie

Unsere Garantiebedingungen können Sie in unseren Allgemeinen Geschäftsbedingungen nachlesen, die Sie hier finden: <https://www.pce-instruments.com/deutsch/agb>.

## 7 Entsorgung

### HINWEIS nach der Batterieverordnung (BattV)

Batterien dürfen nicht in den Hausmüll gegeben werden: Der Endverbraucher ist zur Rückgabe gesetzlich verpflichtet. Gebrauchte Batterien können unter anderem bei eingerichteten Rücknahmestellen oder bei der PCE Deutschland GmbH zurückgegeben werden.

### Annahmestelle nach BattV:

PCE Deutschland GmbH  
Im Langel 4  
59872 Meschede

Zur Umsetzung der ElektroG (Rücknahme und Entsorgung von Elektro- und Elektronikaltgeräten) nehmen wir unsere Geräte zurück. Sie werden entweder bei uns wiederverwertet oder über ein Recyclingunternehmen nach gesetzlicher Vorgabe entsorgt. Alternativ können Sie Ihre Altgeräte auch an dafür vorgesehenen Sammelstellen abgeben.

WEEE-Reg.-Nr.DE69278128



Alle PCE-Produkte sind CE  
und RoHS zugelassen.



## 1 Safety notes

Please read this manual carefully and completely before you use the device for the first time. The device may only be used by qualified personnel and repaired by PCE Instruments personnel. Damage or injuries caused by non-observance of the manual are excluded from our liability and not covered by our warranty.

- The device must only be used as described in this instruction manual. If used otherwise, this can cause dangerous situations for the user and damage to the meter.
- The instrument may only be used if the environmental conditions (temperature, relative humidity, ...) are within the ranges stated in the technical specifications. Do not expose the device to extreme temperatures, direct sunlight, extreme humidity or moisture.
- Do not expose the device to shocks or strong vibrations.
- The case should only be opened by qualified PCE Instruments personnel.
- Never use the instrument when your hands are wet.
- You must not make any technical changes to the device.
- The appliance should only be cleaned with a damp cloth. Use only pH-neutral cleaner, no abrasives or solvents.
- The device must only be used with accessories from PCE Instruments or equivalent.
- Before each use, inspect the case for visible damage. If any damage is visible, do not use the device.
- Do not use the instrument in explosive atmospheres.
- The measurement range as stated in the specifications must not be exceeded under any circumstances.
- Non-observance of the safety notes can cause damage to the device and injuries to the user.

We do not assume liability for printing errors or any other mistakes in this manual.

We expressly point to our general guarantee terms which can be found in our general terms of business.

If you have any questions please contact PCE Instruments. The contact details can be found at the end of this manual.

## 2 Specifications

### 2.1 Technical specifications

Specifications of the meter PCE-CT 80

Specification	Description
Measurement range	Depending on sensor (see sensor chart)
Accuracy	Depending on sensor (see sensor chart)
Resolution	0.1 $\mu\text{m}$ (<100 $\mu\text{m}$ ) 1 $\mu\text{m}$ (>100 $\mu\text{m}$ )
Measurable materials	Magnetic materials (iron, steel...) Non-magnetic materials (paints, plastics, ceramics...)
Min. radius of curvature convex	5 mm
Min. radius of curvature concave	25 mm
Min. measuring surface	$\varnothing$ 17 mm
Min. coating thickness	0.2 mm (magnetic materials) 0.05 mm (non-magnetic materials)
Probe mode	Automatic mode with material recognition (Fe + NFe) Magnetic mode (Fe) Eddy current (NFe)
Measure mode	Single measurement
Calibration	Multi-point calibration (1 ... 4 points per group) Zero-point calibration
Units	$\mu\text{m}$ / mm / mils
Data transfer	Data transfer via USB 2.0
Memory	One group of measurements (DIR mode) that is lost when meter is turned off Four groups of measurements with auto save and max. 2000 readings (GEN mode) <b>Note:</b> Each group of measurements has individual statistics, alarm thresholds and calibration
Statistic functions	Number of readings, mean value, minimum, maximum, standard deviation
Alarm	Indication when set upper and lower alarm thresholds are exceeded or fallen below
Operating time	Auto Power Off function
Power supply	3 x 1.5 V AAA batteries
Display	128 x 128 LCD
Displayed information	Battery level Fault detection
Operating conditions	0 °C... +50 °C 20 %... 90 % RH non-condensing
Storage conditions	-10 °C... +60 °C 20 %... 90 % RH non-condensing
Dimensions	143 x 71 x 37 mm (L x W x H)
Weight incl. probe	approx. 271 g

## Specifications of the selectable probes

Specification	Description		
Type	Ø [mm]	Measurement range [µm]	Accuracy
PCE-CT 80-FN0,5	17	Fe: 0 ... 500 NFe: 0 ... 500	±(1 % of rdg. + 1 µm)
PCE-CT 80-FN1,5	17	Fe: 0 ... 1500 NFe: 0 ... 1500	±(2 % of rdg. + 1 µm)
PCE-CT 80-FN2	17	Fe: 0 ... 2000 NFe: 0 ... 2000	±(2 % of rdg. + 1 µm)
PCE-CT 80-FN2,5	17	Fe: 0 ... 2500 NFe: 0 ... 2500	±(2 % of rdg. + 1 µm)
PCE-CT 80-FN3	17	Fe: 0 ... 3000 NFe: 0 ... 3000	±(2 % of rdg. + 1 µm)
PCE-CT 80-F5N3	17	Fe: 0 ... 5000 NFe: 0 ... 3000	±(2 % of rdg. + 1 µm)

## 2.2 Delivery contents

- 1 x coating thickness gauge PCE-CT 80
- 1 x probe FN1,5
- 3 x AAA batteries
- 1 x carrying case
- 1 x set of standard foils
- 1 x calibration plates (Fe and NFe)
- 1 x user manual

## 2.3 Optional accessories

- Probe PCE-CT 80-FN0,5
- Probe PCE-CT 80-FN2
- Probe PCE-CT 80-FN2,5
- Probe PCE-CT 80-FN3
- Probe PCE-CT 80-F5N3
- PC software with data cable

### 3 System description

#### 3.1 Device



- 1. LC display
- 2. LED red
- 3. LED green

- 4. Membrane keypad
- 5. Probe


#### 3.2 Interfaces



- 1. Probe socket





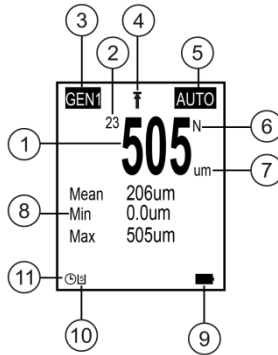


- 2. Micro USB 2.0 connector

### 3.3 Display



- |                        |  |
|------------------------|--|
| 1. Reading             | 7. Unit                                      |
| 2. No. of readings     | 8. Statistics (Mean, minimum, maximum value) |
| 3. Memory group        | 9. Battery level                             |
| 4. Limit value display | 10. USB communication status                 |
| 5. Probe mode          | 11. Auto Power Off                           |
| 6. Material setting    |  |

### 3.4 Function keys



Key	Designation	Functions	
		Measure mode	Menu mode
	On/off	On/off (2 s)	On/off (2 s)
	Calibration	Start and stop calibration	/
	Zero point calibration	Start and stop zero point calibration	Back to measuring mode directly
		Press and hold during device start-up to reset meter to factory settings	
	Enter	Open menu	Save, select, confirm
	Back	Backlight on/off	Cancel, back, close
	Up	Delete readings	Up, increase value
	Down	Refresh screen	Down, decrease value

## 4 Getting started

### 4.1 Power supply




 



For power supply, three AAA Alkaline batteries are required. Before replacing the batteries, turn off the meter. The battery compartment is located at the rear side of the meter and fixed with two screws. Loosen the screws, remove the cover, insert the batteries as marked and close the battery compartment by tightening the screws.


### 4.2 Preparation

To turn on the meter, press  until the display reacts. After charging, the meter will show the measuring screen. To turn off the meter, press . Connect the included probe FN1,5 to the probe socket of the meter. Make sure that the plug is in the right position. The arrow must be visible from the front side of the meter.

### 4.3 Options

To change the standard settings, navigate to the submenu "Options". Follow these steps:

5. Press  to enter the "Root" menu.
6. Use the  key to go to "Options" and confirm with .
7. Navigate to the desired settings with the  keys and confirm with .
8. Select an element with  and confirm with .

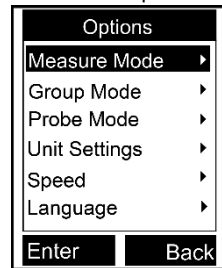

Setting	Element	Description
Measure mode	Single	Individual measurements
Group mode	DIR, GEN General 1, General 2, General 3, General 4	DIR (Direct): Data are lost when the meter is turned off. When the memory is full, the last readings are deleted. GEN (General 1-4): The data are saved to one of the 4 groups and are not lost when turning off the meter. When the memory is full, measurements are still possible but not saved and "fl" is displayed.
Probe mode	Auto, FE, N- FE	Auto: The substrate material is recognised automatically. FE: You can measure on magnetic materials only. N-FE: You can measure on non-magnetic materials only. When the meter recognises a magnetic material, it displays an "F". If the material is non-magnetic, it displays an "N".
Unit settings	µm, mils, mm	Selection of measuring unit

Setting	Element	Description
Speed	Normal, fast	The higher the speed, the lower the accuracy will be.
Language	German, English, Russian, Chinese	Selection of one out of four languages
Auto Poweroff	Deactivate Activate	After inactivity for a certain period, the device turns off automatically. Before powering off, the meter will beep several times. By pressing any key, you can cancel this process.

## 5 Operation

Before making a measurement or calibration, you should be aware of the factors that can influence the measuring accuracy. These influences are listed in the following chart.

Influencing factor	Measuring principle		Recommendation
	Magnetic	Eddy current	
Magnetic properties	x		Calibrate meter
Electrical properties		x	Calibrate meter
Material radius	x	x	Chapter 2.1 Calibrate meter
Material thickness	x	x	Chapter 2.1 Calibrate meter
Size of measuring surface	x	x	Chapter 2.1 Calibrate meter
Surface roughness	x	x	
Position and shape	x	x	
Sample deformation	x	x	Do not measure objects which are too soft or too thin
Glue	x	x	Clean probe and measuring surface
Strong magnetic fields	x		Avoid strong magnetic fields
Temperature and air humidity	x	x	Re-calibrate under the same environmental conditions
Measuring processes	x	x	Chapter <b>Fehler! Verweisquelle konnte nicht gefunden werden.</b>
Low battery	x	x	Replace battery
Probe wear	x	x	Contact PCE Instruments


## 5.1 Calibration

The meter should be calibrated (zero point / multi-point calibration) each time a new sample is measured. The material properties and the radius of curvature of the uncoated calibration surface should be as similar as possible to those of the sample. Make sure to choose similar calibration/measuring points, particularly when measuring corners and edges of small parts. The radius of curvature, the minimum coating thickness and minimum measurement range stated in chapter 2.1 should be observed. The meter offers zero-point and multi-point calibration. Each memory group has its individual zero-point and multi-point calibration. The values previously measured are not affected by a new calibration.

### 5.1.1 Zero-point calibration

A zero-point calibration must be made on an uncoated calibration surface. If it is not possible to calibrate the meter on the sample, please use the calibration plates that come with the meter. A zero-point calibration is recommended where the measuring accuracy is  $\pm(2\% + 1\ \mu\text{m})$ . To carry out a zero-point calibration, follow these steps:


1. Press and hold  $\text{MEM}$  until you hear three beep sounds and "ZERO" is displayed.
2. Place the probe on the uncoated calibration surface and lift it as soon as you hear a beep sound.
3. Repeat that step several times in order to get a mean value.
4. Press  $\text{MEM}$  to leave zero-point calibration.

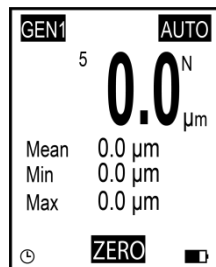

### 5.1.2 Multi-point calibration

The meter's multi-point calibration feature allows up to 4 calibration points to be considered. When making a single-point calibration, the calibration value should be as similar as possible to the expected measurement value. When making a multiple-point calibration, the expected measurement values should be somewhere between the calibration values. The permissible maximum measurement error is  $\pm(2\% + 1\ \mu\text{m})$ .



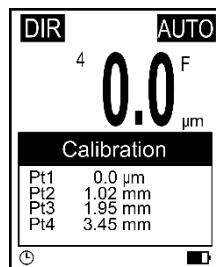


1. If you have already made a calibration, you have to delete the existing calibration values first, as described in chapter 5.1.3. If not, start with the next step.
2. In measure mode, press  $\text{CAL}$  to open the calibration dialogue which can be enabled or disabled in the calibration settings.
3. If you have previously made a zero-point calibration, the zero point will be used as the first calibration point. If not, follow the steps described in chapter 5.1.1.
4. Place one of the included standard foils on the uncoated calibration surface.
5. Place the sensor on the foil and remove it when you hear a beep sound. The reading will now be displayed.
6. Use the  $\text{DEC}$  and  $\text{MEM}$  keys to adapt the reading to the actual foil thickness (flashing value) and confirm with  $\text{ENTER}$ . The calibration point will then be displayed in the dialogue box (non-flashing value). You can cancel the procedure with  $\text{BACK}$ .
7. Repeat these steps if you wish to get all four calibration points. Use a different standard foil for each calibration point.
8. Press  $\text{CAL}$  to exit the multi-point calibration.












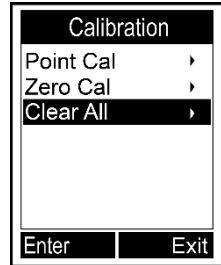



### 5.1.3 Delete calibration

To start a new calibration, you can delete the calibration points recorded during zero-point calibration and during multi-point calibration individually. Follow these steps:



 







1. Press  to enter the "Root" menu.
2. Use the    keys to navigate to "Calibration" and confirm with .
3. Select according to the following subsections (a, b, c) what values you would like to delete.









#### a) Delete multi-point calibration values

1. Navigate to "Point Cal" by using the    keys and confirm with .
2. Use the    keys to navigate to "Clear Magnetic" or "Clear Magnetic" as required and confirm with .
3. A dialogue box opens. Confirm with  to delete the calibration values or cancel the procedure with .

#### b) Delete zero-point calibration values

 1. Use the    keys to navigate to "Zero Cal" and confirm with .
2. Use the    keys to navigate to "Clear Magnetic" or "Clear Magnetic" as required and confirm with .
3. A dialogue box opens. Confirm with  to delete the calibration values or cancel the procedure with .

#### c) Delete all calibration values

1. Use the    keys to navigate to "Clear All" and confirm with .
2. A dialogue box opens. Confirm with  to delete all calibration values or cancel the procedure with .

## 5.2 Measurement











Procedure:


1. First connect the desired probe as described in chapter 4.2.
2. Make the required device settings (measure mode, group mode, probe mode, speed, etc.) as described in chapter 4.3.
3. Make a zero-point calibration and a multi-point calibration before the measurement (chapter 5.1).
4. Place the probe vertically on the surface to be measured. Lift the probe when you hear the beep sound.

## 5.3 Further functions







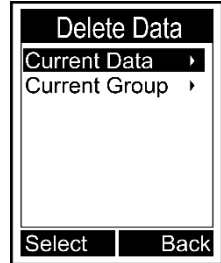



### 5.3.1 Delete data

#### Delete last reading

- In measure mode, press , to delete the last recorded reading.
- 1. Press  to enter the "Root" menu.
- 2. Use the   keys to navigate to "Delete Data" and confirm with .
- 3. Use the   keys to navigate to "Current Data" and confirm with .
- 4. A dialogue box opens. Confirm with  to delete the last reading or cancel the procedure with .










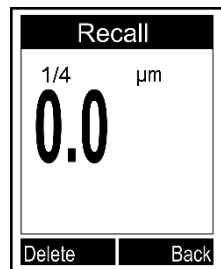
#### Delete current memory group

- In measure mode, press and hold  until you hear another beep sound if you want to delete all values saved in a memory group.
- 1. Press  to enter the "Root" menu.
- 2. Use the   keys to navigate to "Delete Data" and confirm with .
- 3. Use the   keys to navigate to "Current Group" and confirm with .
- 2. A dialogue box opens. Confirm with  to delete all readings saved in the memory group or cancel the procedure with .





To delete other memory groups and values, change the memory group as described in chapter 4.3 and follow the steps above again.


### 5.3.2 Delete values

Press  to enter the "Root" menu. Navigate to "Recall" with the   keys and confirm with . In the upper left part of the display, you will now see what value of a memory group has been selected (1/4). Select the desired reading with  . You can delete that reading by pressing .





### 5.3.3 Statistics

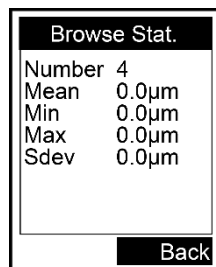When making a measurement in measure mode, the current mean value, the maximum and the minimum values will be displayed below the current reading. To view the complete statistics, press  first. In the menu that is now displayed, go to "Browse Stat." by using the   keys and confirm with . You can now see the statistical values of the currently selected memory group. To view the statistics of the other memory groups, change the memory group as described in chapter 4.3 and go back to the statistics function.


















The meter creates individual statistics based on the saved readings of each memory group. In the statistics, the number of readings, the mean value, the minimum and maximum values as well as the standard deviation will be displayed. When the memory is full in direct mode, the first reading will be deleted and the new reading will be saved. The statistics will be updated accordingly. When the memory is full in general mode, no new readings will be saved and the statistics will not be updated. If you delete the current reading or all readings of the group, the statistics will update.

### 5.3.4 Limit settings







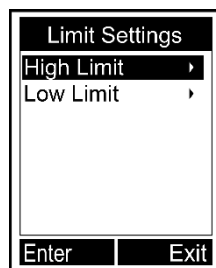


Each memory group has its own upper and lower limit value. When changing the memory group, the limit values will be switched automatically. When a limit value is exceeded/fallen below, the red LED on the left will flash. Moreover, a  will be displayed when the upper limit has been exceeded or a  if the lower limit has been fallen below.

To enter the upper and lower limit value, follow these steps:

1. Press  to enter the "Root" menu.
2. Navigate to "Limit" with the   keys and confirm with .
3. Navigate to "Settings" with the   keys and confirm with .
4. Use the   keys to navigate to "High Limit" or "Low Limit" and confirm with .
5. Set the limit value with   and confirm with  or cancel the procedure with .




To enter the upper and lower limit value, follow these steps:

1. Press  to enter the "Root" menu.
2. Navigate to "Limit" with the   keys and confirm with .
3. Navigate to "Clear" with the   keys and confirm with .
4. A dialogue box opens. Confirm with  to delete the readings of the memory group or cancel the procedure by pressing .







To enter or delete the limit values of other memory groups, change the group as described in chapter 4.3 and follow the steps described above again.

### 5.3.5 USB communication (only possible with optional software)

The meter can be connected to a PC for communication via the micro USB 2.0 connector. To do so, first install the software and the USB driver for the meter. Then connect the meter to your computer by using the USB cable. If the connection has been successful, you will see the  icon at the bottom of the display. You can now organise, format, print or copy the measured data on your PC.

### 5.3.6 System reset

To reset the meter to its factory default settings, follow these steps:

5. Press  to turn off the meter.
6. Press and hold , while turning on the meter with .
7. Release the  key when the dialogue box for the system reset is displayed.
8. To reset the meter, confirm with  or cancel the procedure with . The meter will restart automatically.

## 6 Warranty

You can read our warranty terms in our General Business Terms which you can find here: <https://www.pce-instruments.com/english/terms>.

## 7 Disposal

For the disposal of batteries in the EU, the 2006/66/EC directive of the European Parliament applies. Due to the contained pollutants, batteries must not be disposed of as household waste. They must be given to collection points designed for that purpose.

In order to comply with the EU directive 2012/19/EU we take our devices back. We either re-use them or give them to a recycling company which disposes of the devices in line with law.

For countries outside the EU, batteries and devices should be disposed of in accordance with your local waste regulations.

If you have any questions, please contact PCE Instruments.





## PCE Instruments contact information

### Germany

PCE Deutschland GmbH  
Im Langel 4  
D-59872 Meschede  
Deutschland  
Tel.: +49 (0) 2903 976 99 0  
Fax: +49 (0) 2903 976 99 29  
info@pce-instruments.com  
www.pce-instruments.com/deutsch

### Germany

Produktions- und  
Entwicklungsgesellschaft mbH  
Im Langel 26  
D-59872 Meschede  
Deutschland  
Tel.: +49 (0) 2903 976 99 471  
Fax: +49 (0) 2903 976 99 9971  
info@pce-instruments.com  
www.pce-instruments.com/deutsch

### The Netherlands

PCE Brookhuis B.V.  
Institutenweg 15  
7521 PH Enschede  
Nederland  
Telefoon: +31 (0)53 737 01 92  
Fax: +31 53 430 36 46  
info@pcebenelux.nl  
www.pce-instruments.com/dutch

### United States of America

PCE Americas Inc.  
711 Commerce Way suite 8  
Jupiter / Palm Beach  
33458 FL  
USA  
Tel: +1 (561) 320-9162  
Fax: +1 (561) 320-9176  
info@pce-americas.com  
www.pce-instruments.com/us

### France

PCE Instruments France EURL  
23, rue de Strasbourg  
67250 Soultz-Sous-Forêts  
France  
Téléphone: +33 (0) 972 3537 17  
Numéro de fax: +33 (0) 972 3537 18  
info@pce-france.fr  
www.pce-instruments.com/french

### United Kingdom

PCE Instruments UK Ltd  
Units 11 Southpoint Business Park  
Ensign Way, Southampton  
Hampshire  
United Kingdom, SO31 4RF  
Tel: +44 (0) 2380 98703 0  
Fax: +44 (0) 2380 98703 9  
info@industrial-needs.com  
www.pce-instruments.com/english

### Chile

PCE Instruments Chile S.A.  
RUT: 76.154.057-2  
Calle Santos Dumont N° 738, Local 4  
Comuna de Recoleta, Santiago  
Tel. : +56 2 24053238  
Fax: +56 2 2873 3777  
info@pce-instruments.cl  
www.pce-instruments.com/chile

### Turkey

PCE Teknik Cihazları Ltd.Şti.  
Halkalı Merkez Mah.  
Pehlivan Sok. No.6/C  
34303 Küçükçekmece - İstanbul  
Türkiye  
Tel: 0212 471 11 47  
Faks: 0212 705 53 93  
info@pce- cihazlari.com.tr  
www.pce-instruments.com/turkish

### Spain

PCE Ibérica S.L.  
Calle Mayor, 53  
02500 Tobarra (Albacete)  
España  
Tel. : +34 967 543 548  
Fax: +34 967 543 542  
info@pce-iberica.es  
www.pce-instruments.com/espanol

### Italy

PCE Italia s.r.l.  
Via Pesciatina 878 / B-Interno 6  
55010 Loc. Gragnano  
Capannori (Lucca)  
Italia  
Telefono: +39 0583 975 114  
Fax: +39 0583 974 824  
info@pce-italia.it  
www.pce-instruments.com/italiano

### Hong Kong

PCE Instruments HK Ltd.  
Unit J, 21/F., COS Centre  
56 Tsun Yip Street  
Kwun Tong  
Kowloon, Hong Kong  
Tel: +852-301-84912  
jyi@pce-instruments.com  
www.pce-instruments.cn

### China

PCE (Beijing) Technology Co., Limited  
1519 Room, 6 Building  
Zhong Ang Times Plaza  
No. 9 Mentougou Road, Tou Gou District  
102300 Beijing  
China  
Tel: +86 (10) 8893 9660  
info@pce-instruments.cn  
www.pce-instruments.cn



User manuals in various languages (français, italiano, español, português, nederlands, türk, polski, русский, 中文) can be found by using our product search on: [www.pce-instruments.com](http://www.pce-instruments.com)

Specifications are subject to change without notice.

